



Ram Truck 1500 4WD Differential Housing Repair

Front Right, 2012-Up – Intermediate Shaft - Repair Kit 94-2592




Needle Bearing Included

OE Problem

Clunking (or) vibration noises when trying to apply 4WD. The dashboard light indicates the Shift Actuator is working but it will not engage in 4WD.

Issue:

The front right differential Intermediate Shaft to C.V. inboard joint splines are stripped which also causes a bearing failure.

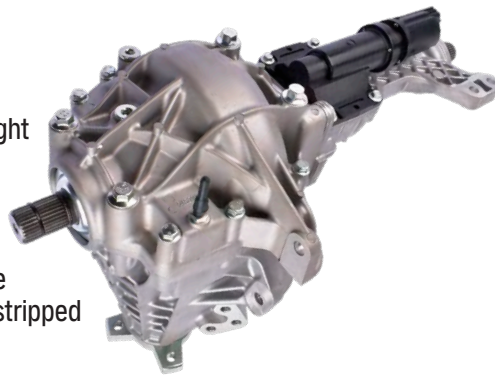

NAPA Solution

NAPA Kit 94-2592 (Rebuild Kit) includes all necessary parts, including a new intermediate shaft with all the components required to complete the repair, without having to spend thousands of dollars for a new differential.

Customer Alert / Recommendation:

The original connecting C.V. Shaft could also be defective if the intermediate shaft is damaged and should be replaced.

We strongly recommend replacing the C.V. Shaft with a new NAPA 94-9247, 94-1754 or 94-1737 when completing the job.



94-9247 OE Replacement C.V. Axle



94-1754 Extreme Environment C.V. Axle



94-1737 Extended Travel C.V. Axle

Note: If “upgrading” to the 94-1754 (or) 94-1737, the CV Axles should be installed in pairs (left & right) to ensure proper performance.

Do the Job Right the First Time, Save Money, Aggravation, and Additional Repairs Down the Road!